

LDCO800 Replacement Parts Compatibility

In August 2010, Linear introduced LDCO800 operator and its field replaceable control board HAE00050. Picture below shows key components to help you identify original LDCO800.




HAE00050 rev A, B, C, D or E

Wrap Cover with Foam

Motor with Boot

Starting with manufacturing date code MD1104 (April 2011), Linear upgraded LDCO800. Linear is introducing **NEW** field replaceable control board part number HAE00060 which is compatible with all of LDCO800. Picture below shows key components to help you identify new upgraded operator.

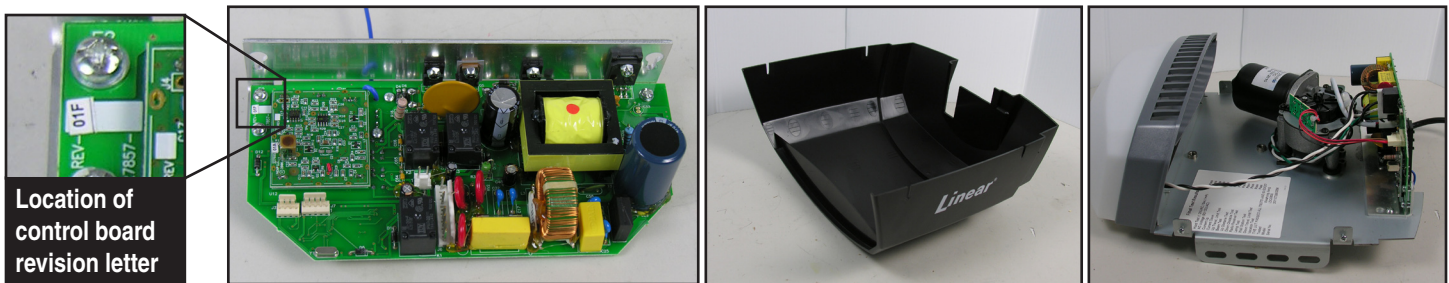

HAE00060 rev F

Wrap Cover No Foam

Motor No Boot

HAE00050 is discontinued. Use **ONLY** following compatible replacement parts for operator performance and compliance.

LDCO800 Replacement Parts Compatibility		
Replacement Part Description	LDCO800	Upgraded LDCO800
Control Board	HAE00050, HAE00060	HAE00060
Motor with Encoder/Wheel	HAE00053	HAE00057
Encoder	HAE00054	HAE00058

As a standard installation practice and compliance to UL safety standards, Linear reminds installers that whenever a control board of garage door operator is replaced in the field, the operator must be set, checked and verified to ensure proper operation and safety features. System setup of LDCO800 is: Adjustment of open and close limits, Automatic Door Force, Safety Reversal System Test.

All these brands are now under one name.

